

# CONTENT

Warning	1
I. Introduction	3
II. Technical Specifications	4
1. Base Conditions and Working Conditions	4
2. General Specification	4
3. Intrinsic error and performance indicators under	base
conditions	6
III. Tester Structure	7
IV. LCD Display	8
V. Measuring Principle	9
VI. Operation Methods	10
1. Switch On/Off	10
2. Battery Voltage Check	10
3. AC Voltage Measurement	10
4. Earth Voltage Measurement	11
5. 4-wires Precise Earth Resistance Measurement	12
6. 3-Wires Earth Resistance Measurement	13
7. 2-Wires Simple Measurement	14
8. Soil Resistivity Measurement	15
9. Backlight Control	17
10. Alarm Settings	17
11. Data Lock/Storage	17
12. Data Reading/Deletion	17
13. Data Upload	18
VII. Battery Replacement	18
VIII. Accessories	19

# Warning

 $\wedge$ 

Thanks for your purchase of ETCR3000B Earth Resistance Soil Resistivity Tester of our company. For better use of the product, please make sure:

---to read this user manual in details.

---to abide by the safety regulations and precautions strictly.

- **u** The tester is conforming to IEC61010 on design, production and test.
- **u** Under any circumstance, it shall pay special attention on safety in use of this tester.
- **u** Pay attention to words and symbols stick on the Tester.
- It shall make sure that tester and accessories are in good condition before use; it can be used only when there is no damaged, naked or broken part in testing wires or insulation layer.
- **u** During measurement, it is forbidden to touch bare conductors and circuit under measurement.
- **u** Before measurement, please confirm whether **FUNCTION** rotary switch has been set within the proper measuring range.
- **u** Confirm that connector plug of lead has been inserted in the tester interface closely.
- **u** Please don't impose over 600V A.C. or D.C. voltage on the part between testing end and interface. Otherwise, it may have damage on the tester.
- **u** Please don't measure in an inflammable place. The flame sparkle maybe cause explosion.

- **u** During usage of tester, please stop using it when exposed metal is caused by broken enclosure or testing wires.
- Please don't keep or store the tester in the spot with high-temperature and moisture, or condensation, and under direct daylight radiation for a long time.
- **u** If the instrument is damp, please dry it before keeping.
- For replacing battery, please confirm testing wire has moved apart the meter, and FUNCTION rotary switch is in "OFF" position.
- **u** Please put the used batteries in appointed collection place.
- **u** The Tester has no auto shut-off function. Please set **FUNCTION** rotary switch to "**OFF**" after usage.
- When the meter displays battery low voltage symbol ■, and you need to replace the battery in time.
- **u** If the Tester is not going to be used for a long period, remove the battery.
- **u** Pay attention to measuring range and usage environment stipulated for the Tester.
- **u** This measuring device is only to be used, disassembled, adjusted and repaired by qualified personnel with authorization.
- When it may cause hazard by continuous use for the reason of the Tester itself, it shall immediately stop using it and deposit it at once, leaving it for disposal by authorized agency.
- For risk of danger icon in manual <sup>(1)</sup>, users must perform safety operations strictly in compliance with the manual content.

# I. Introduction

ETCR3000B Earth Resistance Soil Resistivity Tester is specially designed and manufactured for measuring earth resistance, soil resistivity, earth voltage, AC voltage. Adopting the latest digital and micro-processing technology, precise 4-pole, 3-pole and simple 2-pole method for earth resistance measurement, importing FFT and AFC technology, with a unique function of anti-interference capability and the ability to adapt to the environment, consistency of repeat testing, to ensure high precision, high stability and reliability for prolonged widely used measure. which is in electric power, telecommunications, meteorology, oil field, construction, lightning protection, industrial electrical equipment and other earth resistance, soil resistivity, earth voltage, AC voltage measurement.

**ETCR3000B Earth Resistance Soil Resistivity Tester** is composed of host machine, monitoring software, testing wires, auxiliary ground pillars, communication wires and others. The large LCD display of host machine is with blue backlight and bar graph indicating that can be seen clearly. At the same time it can store 300 sets of data, fulfilling historical inquiry and online real-time monitoring through monitoring software, dynamic display, alarm indicator, and with the functions like historical data access, reading, preservation, report forms, printing and so on.

**ETCR3000B Earth Resistance Soil Resistivity Tester** also named: Precise Earth Resistance Tester, 4-pole Earth Resistance Tester, 2/3/4-pole Earth Resistance Tester, Soil Resistivity Tester.

# **II. Technical Specifications**

## 1. Base Conditions and Working Conditions

Influence Qua	ntity	Base Condition	Working Conditions	Remark
Ambient Ten	np	23℃±1℃	<b>-10°</b> ℃ <b>-40°</b> ℃	
Ambient Humi	dity	40%-60%	< 80%	
Working Voltage		9V±0.1V	9V±1.5V	rC、rP
Auxiliary Earth Resistance		<100Ω	$<$ 30k $\Omega$	
Interference Voltage		no	<20V	
Interference Current		no	<2A	
Electrode Distance when measuring R		a>5d	a>5d	
Electrode Distance when measuring ρ		a>20h	a>20h	
2. General Specification				
Function	Measurement of 2/3/4-pole earth resistance, soil resistivity, earth voltage, AC voltage			
Dawar Cumulu	DC 9\	/ (Zi-Mn dry	battery R14S 1.5V	6 PCS,

Power Supply	DC 9V (ZI-Mn dry battery R14S 1.5V 6 PCS, continuous standby for 300 hours )		
Measurement	Earth Resistance: 0.00Ω-30.00kΩ		
Range	Soil Resistivity: 0.00Ωm-9000kΩm		
Measuring	Precise 4-pole measurement, 3-pole measurement,		
Mode	simple 2-pole measurement		
Measuring Method	Earth Resistance: rated current change-pole method, measurement current 20mA Max Soil Resistivity: 4-pole measurement (Wenner method) Earth Voltage: average rectification(between P(s)-ES)		
Test Frequency	128Hz/111Hz/105Hz/94Hz(AFC)		
Short-circuit Test Current	AC 20mA max		
Open-circuit Test Current	AC 40V max		
Test Voltage Wave	Sine wave		
Electrode Distance Range	Can be set 1m-100m		

Ch:#	Earth Resistance: $0.00\Omega$ -30.00k $\Omega$ , automatic shift		
ອາເຫ	Soil Resistivity: 0.00Ωm-9000kΩm, automatic shift		
Backlight	Blue screen backlight, suitable for dim places		
Display Mode	4-digital super-large LCD display, blue screen backlight		
Measuring Indicator	During measurement, LED flash indicator, LCD count down display, progress bar indicator		
LCD Frame Dimension	128mm×75mm		
LCD Window Dimension	124mm×67mm		
Dimension	L×W×H: 215mm×190mm×95mm		
Standard Test Wire	4 wires: each for red 20m, black 20m, yellow 10m, and green 10m		
Simple Test Wire	2 wires: each for red 1.6m and black 1.6m		
Auxiliary Earthing Rod	4 rods: Φ10mm×150mm		
Measuring Rate	Earth voltage: about 3 times/second Earth resistance, soil resistivity: about 5 seconds/time		
Measuring	Over 5000 times (Short-circuit test, interval time		
Times	should be at least 30 seconds)		
Line Voltage	below AC 600V		
RS232 Interface	Possess RS232 interface, software supervision, storage data can be uploaded to computer, saved or printed.		
Communication Wire	One piece of RS232 communication wire, with length 1.5m		
Data Storage	300 sets, " <b>MEM</b> " icon storage indicator, flash display "FULL" icon to indicate storage is full		
Data Hold	Data hold function: "HOLD" icon display		
Data Access	Data read function: " <b>READ</b> " icon display		
Overflow Display	Exceeding measuring range overflow function: " <b>OL</b> " icon display		
Interference Test	Recognize interference signal automatically, "NOISE" icon display when interference voltage exceed 5V		
Auxiliary Earthing Test	Can measure auxiliary earth resistance, $0.00K\Omega$ - $30k\Omega(100R+rC<50k\Omega, 100R+rP<50k\Omega)$		
Alarm Function	When measuring value exceeds alarm setting value, there is "Toot-toot-toot" alarm hint		
Battery Voltage	When battery voltage decreases to about 7.5V,		

	battery voltage low icon will display, reminding to replace battery.		
	Standby: about 20mA (Backlight shut off)		
Power	Boot and with backlight: about 45mA (25mA without		
Consumption	backlight)		
	Measurement: about 100mA (Backlight shut off)		
	Total weight: 4.5kg (including package)		
Mainht	Tester: 1443g (including battery)		
weight	Testing wires: 1560g		
	Auxiliary earthing rods: 935g (4pcs)		
Working			
Temperature &	-10℃-40℃, below 80%rh		
Humidity			
Storage			
temperature &	ture & _20°C-60°C, below 70%rh		
humidity			
Overload	Measuring earth resistance: between each interfaces		
Protection	of C(H)-E (S)-ES, AC 280V/3 seconds		
Insulation	Quer 20MQ (between size it and analogure it is 500)()		
Resistance			
Withstanding	AC 2700)//max (Between sizewit and enclosure)		
Voltage	AC 5700 VIIIIS (Delween circuit and enclosure)		
Electromagnetic	1EC61226(EMC)		
Features	12001320(EINC)		
	IEC61010-1 (CAT III 300V, CAT IV 150V, Pollution 2),		
Protection Type	IEC61010-031, IEC61557-1 (Earth resistance),		
	IEC61557-5 (Soil resistivity), JJG 366-2004		

# 3. Intrinsic error and performance indicators under base conditions

Category	Measurement Range	Intrinsic Error	Resolution
Forth	0.00Ω-30.00Ω	±2%rdg±3dgt	0.01Ω
Earth	30.0Ω-300.0Ω	±2%rdg±3dgt	0.1Ω
(P)	300Ω-3000Ω	±2%rdg±3dgt	1Ω
(13)	3.00kΩ-30.00kΩ	±4%rdg±3dgt	10Ω
Soil Resistivity	0.00Ωm-99.99Ωm	According to	0.01Ωm
(ρ)	100.0Ωm-999.9Ωm	the precision of	0.1Ωm

	1000Ωm-9999Ωm	R	1Ωm
	10.00kΩm-99.99kΩm	(ρ=2πaR	10Ωm
	100.0kΩm-999.9kΩm	a:1 m-100m,	100Ωm
	1000kΩm-9000kΩm	π=3.14)	1kΩm
Earth Voltage	AC 0.0-600V	±2%rdg±3dgt	0.1V

Note: 1. When rC max or rP max, additional error≤±3%rdg±5dgt. (rC max:  $4k\Omega$ +100R<50kΩ, rP max:  $4k\Omega$ +100R<50kΩ)

2. When 5V interference voltage, additional error≤±5%rdg±5dgt.

## III. Tester Structure



- **1.** LCD **2.** Button area
- **3.** Rotary switch for selecting function **4.** RS232 interface
- 5. Interface of testing wires 6. P(S) interface: Voltage electrode
- 7. C(H) interface: Current electrode 8. E interface: Earth electrode
- 9. ES interface: Auxiliary earth electrode 10. Standard test wires
- **11.** Auxiliary earthing rods**12.** Simple test wires

## **IV. LCD Display**



1. Progress bar (Dynamic display the progress of testing)

**2.** Alarm symbol (Display when open alarm function, flash when exceed the alarm value)

**3.** Exceed voltage symbol (Display when the measured voltage exceed 30V, please pay attention to the safety)

4. AC symbol

5. Data hold symbol (Display when press **MEM** to hold data)

**6.** Data access symbol (Display when long press **MEM** for at least 3 seconds to access data)

7. Data storage symbol (Display when press **MEM** to hold data and store)
8. Interference signal symbol (Display when the interference voltage exceed 5V)

**9.** Low battery symbol (Display when the battery voltage decreases to 7.5V)

**10.** Display the group number of stored data, and display countdown.

**11.** Interference electrode symbol (Display when the electrode exceed 5V interference voltage)

12. Measured data

**13.** Voltage unit symbol

**14.** Resistance, soil resistivity, length unit symbol ( $\Omega$ , k $\Omega$ ,  $\Omega$ m, k $\Omega$ m, m)

# V. Measuring Principle

1. Voltage to ground measurement adopts average value rectification method.

2. Earth resistance measurement with fall-of-potential method. AC constant current I is applied between the measurement object **E** earth electrode and **C**(H) current electrode, and finding out the potential difference **V** between **E** earth electrode and **P**(s) voltage electrode, calculating the earth ground **R** according to formula **R=V/I**. To ensure the accuracy of test, designed the 4-wires method, increase **ES** auxiliary earth electrode, **ES** and **E** clip on the same point during testing. The 4-wires method can eliminate influence of contact resistance (usually result from dirty or rusty) between measured earthing body, auxiliary earthing rods, test clips, meter's input interface. The 4-wires method can also eliminate influence of line resistance.



3. Maximum Operating Error: Operating error(B) is an error obtained within the rated operating conditions, and calculated with the intrinsic error(A), which is an error of the instrument used, and the error(E) due to variations.

$$\mathsf{B}=\pm(|\mathsf{A}|+1.\ \mathsf{15}\times\sqrt{\mathsf{E}_2^2+\mathsf{E}_3^2+\mathsf{E}_4^2+\mathsf{E}_5^2})$$

- A: Intrinsic error
- E2: Variation due to power supply voltage
- E3: Variation due to temperature change
- E4: Variation due to interference voltage change
- E5: Variation due to contact electrode resistance
- Soil resistivity (ρ) is measured by 4-pole method (Wenner method): There is a AC current I between E earthing electrode and C(H)

current electrode, find the potential difference V between P(s) voltage electrode and ES auxiliary earthing electrode, the potential difference V divided by AC current I is earth resistance R, electrode distance is a(m), then soil resistivity can be got according to formula  $p=2\pi a R(\Omega m)$ . If the electrode distance of C(H)-P(s) is equal to P(s)-ES (both is a) that is for wenner method. In order to simple the calculation, please make electrode distance a far more than embedding depth h, generally should meet a>20h, as shown below.



## **VI. Operation Methods**

#### 1. Switch On/Off

⁄!`

Rotate **FUNCTION** rotary switch to fulfill switch on and off. When rotary switch button displays "**OFF**" for shut-off. The Tester has no auto shut-off function, so please shut it off after usage in case of battery consumption saving.

#### 2. Battery Voltage Check

After switch on, if LCD displays low battery voltage icon ", which indicates that battery voltage is low, and please replace the battery in compliance with instructions. Adequate battery power can ensure the accuracy of measurement.

#### 3. AC Voltage Measurement

Ac line voltage measurement can't exceed 600 V.

Connect P(S) and ES interface to test commercial AC voltage, no need to connect C(H) and E interface.

AC voltage measurement refers to the general commercial AC voltage measurement, pay attention to the difference between earthing voltage, the meter can be used for testing below 600V AC line voltage.

As shown below: Firstly connect test wires with P(s), ES interface, secondly connect test wires with tested line, then rotate FUNCTION

rotary switch to "EARTH VOLTAGE" and start testing, LCD will display the test results. **P**(s)



#### 4. Earth Voltage Measurement

 $\hat{}$ 

Earth voltage measurement need to use one auxiliary earthing rod.
The meter connect with the earth only by testing wires and auxiliary earthing rods. Other testing wires of meter's interface can't connect with commercial power line L, N, otherwise may cause leakage, the breaker may start, it is dangerous.

Earth voltage measurement can't exceed 600 V.

Earth voltage: That is a potential differences between zero potential differences and earthing equipment shell, earthing wires, earthing body when electrical equipment has a earthing fault. Earth voltage is the potential differences between the earth. As a reference point, the earth is zero potential.

Earth voltage measurement need to use one auxiliary earthing rod. Please pay attention to the difference from commercial AC voltage measurement. As shown below: meter, auxiliary earthing rods, testing wires are all connected, rotate **FUNCTION** rotary switch to "**EARTH VOLTAGE**" and start testing, LCD will display the test results.



#### 5. 4-wires Precise Earth Resistance Measurement

In the testing of earth resistance, should firstly confirm the earth voltage of earthing wire, the voltage between C(H) and E or P(s) and ES must under 20V, the meter showing NOISE symbols when the earth voltage exceed 5V, and the measured value of earth resistance may produce error. At this time, firstly interrupt power supply to earthing equipment, make sure the earth voltage decrease, and then test earth resistance again.

4-wires measurement: The 4-wires method can eliminate influence of contact resistance (usually result from dirty or rusty) between measured earthing body, auxiliary earthing rods, test clips, meter's input interface. The 4-wires method can also eliminate influence of line resistance. So it is better than 3-wires measurement.

As shown below: Start from the measured body, interval 5m-20m, respectively insert P(s), C(H) auxiliary earthing rods deep into the earth in a straight line, and then connect testing wires (black, green, yellow, red) from E, ES, P(S), C(H) interfaces corresponding to measured earth electrode E, auxiliary voltage electrode P(s), auxiliary current electrode C(H).

Â	The distance from measured earthing body to current electrode C(H), should at least five times longer than the embedded depth of measured earthing body, or the embedded electrode depth (d).
	When measuring the total earth resistance of complex earthing system d is the length of the biggest diagonal
	line of this earthing system.
	Testing wires can't be winded together, or may affect the
	measuring accuracy.



For multi independent earthing system or larger earth net, 50m or longer testing wire is optional, as shown below:



R=r1//r2//r3//r4//r5//r6//...//rn (r1...rn are all independent earthing points)

**R**—— The reading value on meter, the total earth resistance of the earthing system.

**r1...rn**—— All are independent earthing points, each points have no connection together under the ground.

rC—— The earth resistance rC of auxiliary current electrode C(H).

rP----- The earth resistance rP of auxiliary voltage electrode P(s).

n—— Number of independent earthing point, more points, smaller the R value.

After finishing wires connection, firstly rotate **FUNCTION** rotary switch to "**REARTH**", press "**START**" button to start testing. During testing, display countdown and process bar indicator. Stable earth resistance value is shown when finish testing.

Press "**SET**" button, the earth resistance rC of auxiliary current electrode C(H) and earth resistance rP of auxiliary voltage electrode P(s) will be displayed, and then automatically return display of measured earth resistance R.

As shown below, the measured earth resistance is  $2.05\Omega$ , already stored 8 sets of data. the earth resistance **rC** of auxiliary current electrode **C**(H) is  $0.36K\Omega$ , the earth resistance **rP** of auxiliary voltage electrode **P**(s) is  $0.27K\Omega$ .



#### 6. 3-Wires Earth Resistance Measurement

3-wires measurement: As shown below, short-circuit **ES** and **S** interface, which is 3-wires measurement. The operation of meter is the same with

4-wires measurement. The 3-wires method can't eliminate influence of line resistance, also can't eliminate influence of contact resistance between meter and testing wires, testing wires and auxiliary earthing rods. Meanwhile, oxidation layer on measured earthing body must be removed when measuring.



#### 7. 2-Wires Simple Measurement

When select commercial use power supply system earth as auxiliary earth electrode, it must use detector to confirm that is it the earth ground electrode for commercial use power supply system, otherwise the breaker may start, it is dangerous.

Using 2-wires simple method for measuring earth resistance, try to choose a earthing body which has a small re value as auxiliary earthing electrode, so that the reading value is more close to the real value. The metal pipes, metal fire hydrant have priority in choosing auxiliary earthing electrodes.

2-wires method: This method is a simple method for measurement that does not use auxiliary earthing rod, taking the earth electrode with the minimal existing earth ground resistance value as auxiliary earth electrode, and connecting by two simple testing wires (in which C(H)-P(S), **E-ES** interfaces are in short circuit). It can make use of metal pipes, fire hydrants and other metal buried objects, common earthing of commercial electric power system or lightning protection earth ground electrode and others to replace auxiliary earthing rods C(H),P(S), and pay attention to remove oxide layer on the connection point of the selected metal auxiliary earthing object when making measurement.

Wire connection is as following figure, and refer to 4-wires measurement for other operations.



2-wires simple method for measurement of earth ground resistance, its reading on tester is the total value of earth ground resistance value of measured earthing object and that of commercial earthing object, that is:

#### R=RX+re

In which:

**R** is the tester reading value;

**RX** is the earth ground resistance value of measured earthing object: re is the earth ground resistance value of common earthing object like commercial use power system.

Then, the earth ground resistance value of measured earthing object is: RX=R-re

#### 8. Soil Resistivity Measurement

Soil resistivity  $\mathbf{p}$  is a determining factor of earthing resistance of earthing body. Different nature of the soil, there is a different soil resistivity. Even the same kind of soil, due to different temperature and water content and so on, the soil resistivity will correspondingly have a significant change. Therefore, in order to have a correct basis in the

design of the earthing device, ensure the designed earthing device be more in accord with the need of practical work, soil resistivity measurement is very essential.

Soil resistivity is measured by 4-pole method (Wenner method)

According to formula  $\rho=2\pi a R(\Omega m)$  calculating soil resistivity  $\rho$ , its unit is  $\Omega m$ , in which:

a-electrode distance

R----soil resistivity between electrode P(s)-ES

4-pole method (Wenner method): Connect testing wires as shown below, pay attention to the distance between auxiliary earthing rods, and the embedding depth. Respectively insert C(H), P(s), ES, E auxiliary earthing rods deep into the earth in a straight line, and then connect testing wires (red, yellow, green, black) corresponding to C(H), P(S), ES, E of interfaces and measured auxiliary earthing rods.



Setting distance between auxiliary earthing rods: After finishing wires connection, firstly rotate **FUNCTION** rotary switch to "**PEARTH**", long press "**SET**" button (about 3 seconds) to enter setting, short press "**SET**" button to move the cursor, press "**M**" or "**M**" button to change current data value (**a** range:1m-100m), then long press "**SET**" button to save the set **a** value, and return soil resistivity testing mode.

After setting **a** value, in soil resistivity testing mode, press the "**START**" button to start testing, and countdown display testing process, stable soil resistivity value is shown when finish testing.

As shown below, the measured soil resistivity is  $53.38\Omega m$ , already stored 157 sets of data. Press "**SET**" button, the earth resistance **rC** of auxiliary current electrode **C**(H) and earth resistance **rP** of auxiliary voltage electrode **P**(s) will be displayed, and then automatically return display of measured soil resistivity  $\rho$ .



#### 9. Backlight Control

After startup, press 'B' button to turn on or off backlight. The backlight function is suitable to dark spot, power consumption of backlight is about 25mA. It will default backlight turn-off for each startup.

#### 10. Alarm Settings

After startup, rotate **FUNCTION** rotary switch to select function, press <sup>1</sup>/<sub>4</sub>, button for a brief time to open or shut off alarm function, press <sup>1</sup>/<sub>4</sub>, button for a long time (about 3 seconds) to enter alarm critical value settings, press <sup>1</sup>/<sub>4</sub> or <sup>1</sup>/<sub>4</sub> to change current digital, press <sup>1</sup>/<sub>4</sub> button to move cursor and then press <sup>1</sup>/<sub>4</sub> button to store and exit. When measurement value is larger than alarm critical settings value and it has opened alarm function, the tester will flash and display <sup>1</sup>/<sub>4</sub> icon and give out "toot-toot-toot---"alarming sound.

#### 11. Data Lock/Storage

In test mode, press """ button for a brief time to lock current displayed data, showing """ icon and automatically store with serial numbers. If storage is full, the tester will display """ icon, and then press """ button to remove lock.

As shown in the left figure below: the lock measurement data of soil resistivity is  $53.38\Omega m$ , as the 28th group of data storage.





#### 12. Data Reading/Deletion

In test mode, press """ button for a longer time (over 3 seconds) to enter data reading, press " or " " button to select reading data group number by step value 1, press " or " " button constantly to select reading data group number by step value 10. When the current data is earth resistance or soil resistivity, press " button to read data value of rC, rP and a, then press " button to exit from reading.

On reading if there is no storage data, LCD will display "----", see the above right figure.

Under data reading status, press "Le" button to enter data deletion, press 'Le' or "Le' to select "no" or "yes", selecting "no" and then pressing "CLR" button for not deleting and return data reading status, selecting "yes" and then pressing "CLR" button for deleting stored data and it will show as above right figure after deletion.

**Notice**: Operating data deletion will delete all the stored data one-time, and unable to be restored. Please careful operation.

#### 13. Data Upload

The stored data can be uploaded to computer. Make good connection of computer with RS232 communication wire of the tester, switch on the tester and run monitoring software, and if the software displays that interface is open and the connection is successful, then it can read the stored historical data, upload to company and preserve.

Monitoring software has the function of online real-time monitoring and historical inquiry, dynamic display, with alarm value settings and alarm indicator, and the function of historical data access, reading, preserve, print and other functions.

## **VII. Battery Replacement**

Please don't replace battery in flammable spot

Please don't replace battery during measurement

Pay attention to battery polarity and specification, and don't mix use of new and used battery to avoid damage on tester.

When the enclosure of Tester is wet, please do not open battery cover

Please put the used batteries in appointed collection place.

- 1. Switch off; making sure that the Tester is under switch-off state.
- Loosen the four screws on battery cover at the bottom of the Tester, and open battery cover.
- **3.**Replace new battery, pay attention to battery polarity and specification, close battery cover, and fasten screw.
- 4. Switch on verification, otherwise re-operate.



# **VIII.** Accessories

Tester	1 PC	
Tester Bag	1 PC	
Auxiliary Earthing Rod	4 PCS	
Standard Testing Wire	4 wires: each for red 20m, black	
	20m, yellow 10m, and green 10m	
Simple Testing Wire	2 wires: each for red 1.6m and	
	black 1.6m	
Zinc-manganese Dry Battery	6 PCS (R14S 1.5V)	
Monitoring Software Disk	1 Copy	
RS232 Communication	1 PC	
Cable		
Manual/Warranty Card/Qualification Certificate	1 Сору	

## A Manufactured by

### ETCR Electronic Technology Company Address: F-3F, No.4 Pengshang Zhifu Road, Jiahe, Baiyun

District, Guangzhou, Guangdong, China Post Code: 510440 Tel: (86-20)62199556 62199553 Fax: (86-20)62199550 E-mail: <u>info@etcr.cc</u> Website: <u>www.etcr.cc</u>